Repair of PC 413.

Look at image PC413.JPG,
Check + Volt
Check Coil
Experience with this board, the component U10 (Max 202) for the Serial communication becomes defected.
Remove the old one and replace with a new when you have confirmed that the error is on this board PC 413.
Before you change make sure that you have checked all other options as :
Is the machine turned On ?
Is the cable connected ?
Have you set a com port in the software ? You can test by using Flash Upgrade, but be aware of correct version, always have a backup.
Are the Jumper's correct ? JP2 in Normal modus, JP3 in Program modus
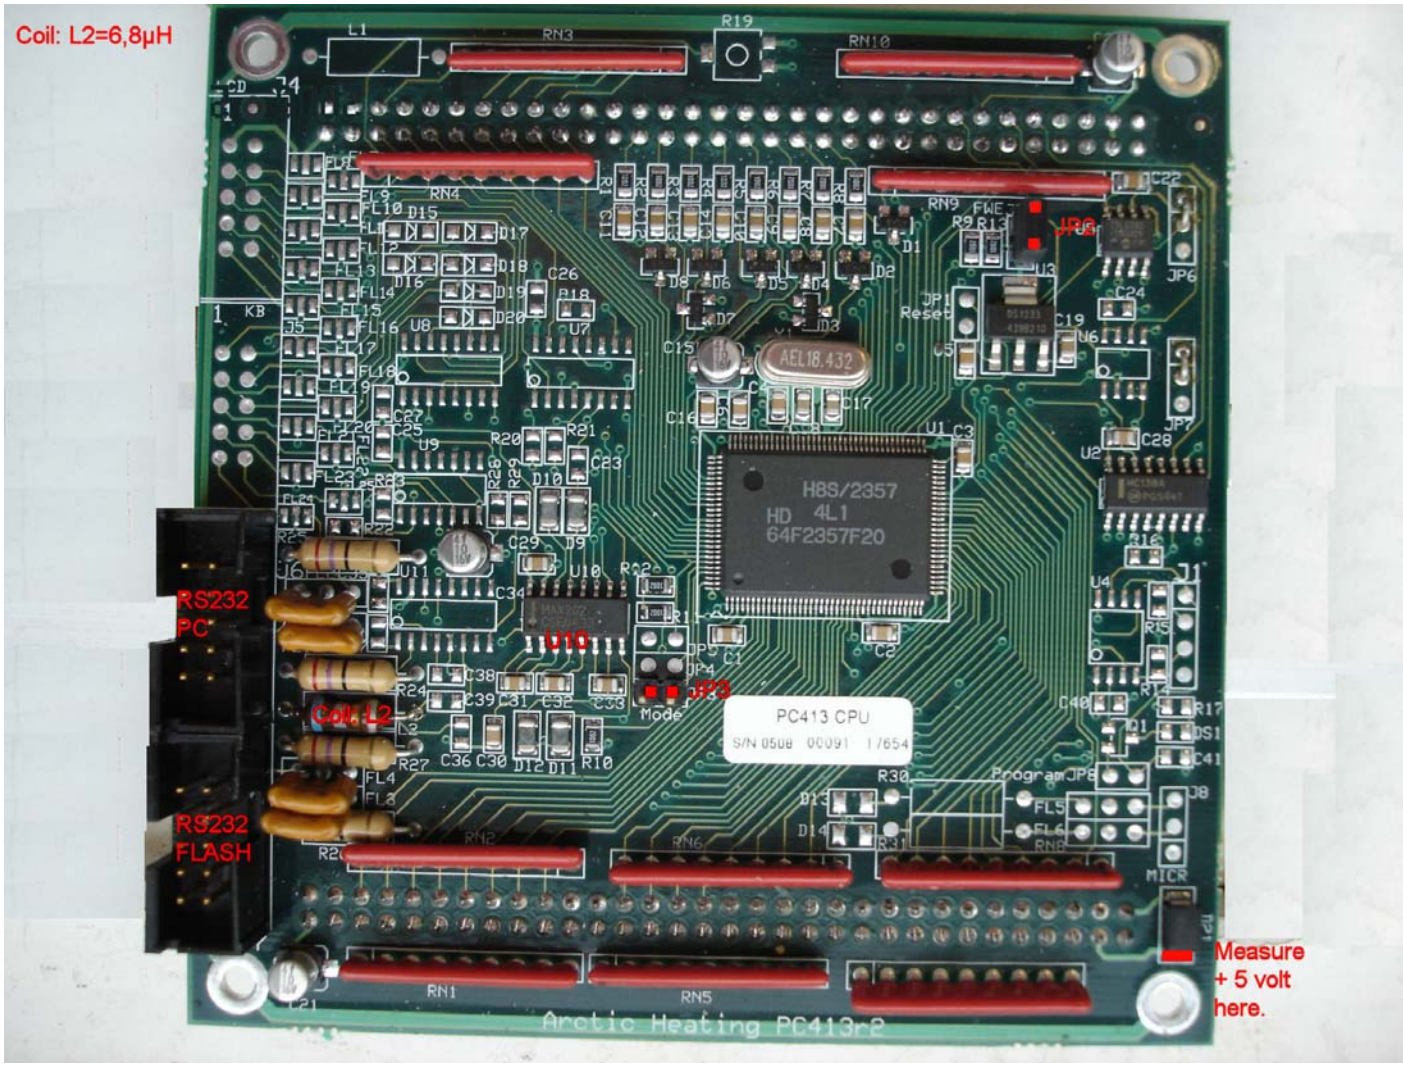
(Board delivered after 10.2.06 should have U10 = ST202ECD)